

PLOTTED BY: purgobut DATE: Tuesday, July 11, 2017 11:12:28 AM  
 PATH: U:\PSO\Projects\Clients\1521-075-ELST\985ves\CA00\Phase 21\T03\Draw  
 LAYOUT: TP1


**TREE REMOVAL AND PRESERVATION NOTES:**

(S) SAVE  
(X) REMOVE

**LEGEND:**  
 CG CG CLEARING AND GRUBBING  
 8000 SIGNIFICANT TREE EVALUATED BY ARBORIST

**GENERAL NOTE:**  
 1. ONLY SIGNIFICANT TREES ARE SHOWN ON THESE PLANS. TREES ARE DEPICTED AS A SYMBOL NOT THE ACTUAL TREE SIZE.

TREE #	SPECIES	DBH (INCHES)	DEFECTS	COMMENTS	PRUNE	RECOMMENDATION
8000	bitter cherry	8, 9 (12)		topped in recent past	N	REMOVE
8001	bitter cherry	10, 8 (13)		topped in recent past	N	REMOVE
8002	bitter cherry	11, 9 (14)		topped in recent past	N	REMOVE
8035	bitter cherry	15	ivy covering trunk	topped in recent past	N	REMOVE
8036	pacific madrone	26	leans w, decay, 40% dieback	topped in recent past	N	REMOVE
8037	pacific madrone	11, 16 (19)	leans w, decay, 20% dieback	topped in recent past	N	REMOVE
8038	pacific madrone	13	cankers, 80% dieback	leans w, topped in recent past	N	REMOVE
8039	pacific madrone	19	decay, 30% dieback	leans w, topped in recent past	N	REMOVE
8040	pacific madrone	18	leans w, decay	leans w, topped in recent past	N	REMOVE
8041	pacific madrone	24	20% dieback	topped in recent past	N	REMOVE
8042	pacific madrone	13	10% dieback	topped in recent past	N	REMOVE
8043	pacific madrone	18	20% dieback	topped in recent past	N	REMOVE
8045	big leaf maple	15, 7, 14, 14 (26)		forks at 1' trunk decay	N	SAVE
8046	big leaf maple	10, 8, 8 (15)		poor trunk taper	N	SAVE
8047	big leaf maple	11, 15, 21 (28)	decay, some dieback	decay, some top dieback/decline	N	SAVE
8048	black cottonwood	29		forks at 5'	N	SAVE
8050	pacific madrone	33, 22	one dead trunk, 30cr, cankers	major decline-diseased, 80% dead	N	REMOVE
8051	big leaf maple	30, 42, 35		significant deadwood in crown	Y	SAVE
8052	pacific madrone	20, 11 (23)	dead codominant stem, 30cr	dead codom stem, decline	Y	SAVE
8053	big leaf maple	21		typical form, moderate deadwood	Y	SAVE
8054	pacific madrone	17	20% crown, leans w over trail	high-risk tree in bad condition, leans west over trail	N	REMOVE
8880	oregon ash	17		no concerning defects	N	SAVE
17496	pacific madrone	20		diseased, heavy lean north	N	REMOVE
17508	pacific madrone	38	rotten at bottom of stump	99% dead	N	REMOVE



TOTAL TREE	SAVE	REMOVE	MONITOR
24	8	16	0

**NOTE:**  
 1. ASSESSMENT OF TREE RETENTION ON THIS PLAN IS BASED ON EXISTING CONDITIONS IN JULY, 2017.


CITY OF SAMMAMISH APPROVAL	
City Engineer _____	Date _____
Community Development _____	Date _____

**REVISED 60% REVIEW SUBMITTAL  
 NOT FOR CONSTRUCTION**

REVISIONS	DATE	BY	DESIGNED
			J. JUN
			B. PURGANAN
			P. JOHANNESSEN
			Y. HO

**ONE INCH AT FULL SCALE, IF NOT, SCALE ACCORDINGLY**

FILE NAME: BL1521075P21T03TP-01  
 JOB No.: 554-1521-075 P21T03  
 DATE: OCTOBER 2016

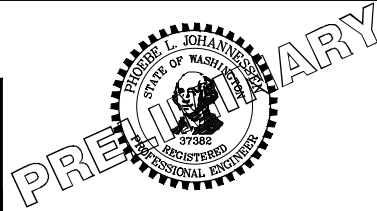

**Parametrix**  
 ENGINEERING · PLANNING · ENVIRONMENTAL SCIENCES

719 2ND AVENUE, SUITE 200 | SEATTLE, WA 98104  
 P 206.394.3700  
 WWW.PARAMETRIX.COM

PROJECT NAME  
**EAST LAKE SAMMAMISH  
 MASTER PLAN TRAIL  
 INGLEWOOD HILL ROAD PARKING LOT**  
 SAMMAMISH, WA

**REVISED TREE PRESERVATION PLAN**

SHEET NO.  
 1 OF 1  
**TP1**